

# DINALOG A 96 x 24 MF

A1410 - MF Light-strip Indicator



	Contents	Pag
1.	Applications	4
<b>2.</b> 2.1	Installation Dimensional Drawing	<b>4</b> 5
3.1 3.2 3.3 3.4	Terminal Assignments Power Supply Measurement Input Output External Control Inputs	<b>6</b> 6 6 7 10
<b>4.</b> 4.1 4.2 4.3	Operation Limit Value-Queries Display Test Measuring Range Selection	11 12 12 13
5.	Basic Device Settings	14
6. 6.1 6.2 6.3 6.4 6.5 6.6 6.7 6.8 6.9 6.10 6.11 6.12 6.13 6.14	Programming Adjusting Display Brightness Light-Strip Adjustment Lower Scale Limit Upper Scale Limit Upper Scale Starting Point Measuring Range Matching for 020 mA, 420 mA und ± 20 mA Measuring Range Matching with HCA (hardware calibration) Measuring Range Matching with PCA (software calibration) Setting the Decimal Point Mean Value Generation and Display Limit Value Function Relay Switching Mode Relay Switching Function Setting Relay Switching Hysteresis	15 18 18 18 19 19 20 21 23 23 23 24 24 25
<b>7.</b> 7.1 7.2	Setting the Limit Values Locking the Selected Limit Values Switching the Digital Display On and Off	<b>25</b> 26 26

	Contens	Pag
8.	Technical Data	27
9.	Repair and Replacement Parts Service DKD Calibration Laboratory and Rental Instrument Service	30
10	Product Support	30

## **Notes and Warnings**

This device has been shipped from the factory in flawless technical safety condition. In order to maintain this condition and to assure hazard-free operation, all notes and warnings which appear in the operating instructions must be observed by the user.

If, due to damage, it may be assumed that hazard-free operation of the device is no longer possible, it must be removed from service. This applies in any event if the device demonstrates visible damage.

Before placing the device into service, it must be assured that the measuring instrument has been configured correctly for the desired application (correct supply voltage, inputs and outputs). Specifica-tions and any included options appear on the device's serial plate. Voltage conducting parts may be exposed if covers are opened, or if components are removed from the device.

Balancing, maintenance and repair of live, open devices may only be carried out by suitably trained personnel, who are aware of the dangers involved.

## 1. Applications

The programmable light-strip indicator is a precision panel meter with adjustable display range. The display range can be adapted measuring ranges after installation without the use of a calibrator. The measuring instrument is thus suitable for applications which require frequent on-site display range adjustments.

The instrument is configured for the evaluation of two limit values. The violations of the limit values are signaled with LED included at the scale. Each of the limit value is connected with a relay.

The measurement input can be configured with jumpers. It may be used for then following measurement tasks:

Direct current: ±0.2mA, 2mA, 20mA (Inc: 0-20mA or 4-

20mA), 200mA

Direct voltage: ± 2V, 10V (Inc: 0-10V or 2-10V), 20V, 200V

#### 2. Installation


Insert the measuring instrument into the control panel cutout from the front without the mounting tabs. Then insert the mounting tabs from the rear into the slots at the device side panels and tighten them against the control panel.




## Attention!


If several devices are installed at maximum component density it must be assured that the maximum allowable operating temperature of 50 °C is not exceeded despite self-heating.

# 2.1 Dimensional Drawing

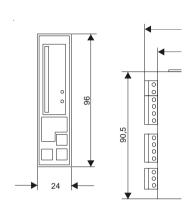


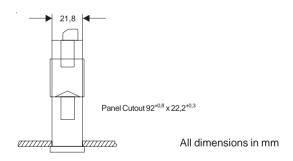

## 3. Terminal Assignments

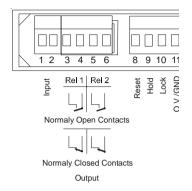


## 3.1 Power Supply



See specifications on the serial plate regarding power supply and connected load.

## 3.2 Measurement Input




U/I-DC

### 3.3 Output

(depending upon device type and relay type)

Relay Type	Relay Terminal Assignments	
-	-	
see serial plate	Relay 1 Relay 2	Terminals 3 and 4 = NO for 1st limit value Terminals 5 and 6 = NO for 2nd limit value
	=	See serial plate Relay 1

The A1410-MF is equipped with two limit values. A relay with one closing contact each (opener contact) is assigned to each limit value. All relay contacts are separate from each other galvanic.

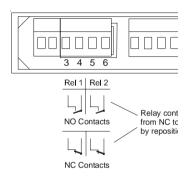

# Changing Relay Contacts from NO to NC (switching mode):


Relays for devices with limit values are set at the factory for normally open operation. The relays can be changed from normally open to normally closed operation with the above mentioned jumpers. The snap-in tabs at the housing rear panel must first be carefully released by lifting the housing shell, after which the housing rear panel can be removed along with the complete PCB. The jumpers at the limit value module must then be configured as shown below.



## Attention!


This work may only be performed by trained personnel who are aware for the dangers involved.

Electrostatically sensitive devices are included in these instruments. The usual protective measures must be observed in order to prevent electrostatic charging of such components. The guarantee is rendered null and void if the instrument is destroyed due to incorrectly implemented changes.

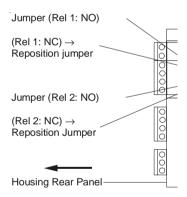


#### Indication of Limit Value Violations

Two LEDs are included at the scale for the indication of limit value violations for devices with two limit values. The switching status of relay 1 is indicated at LED Rel 1, and the switching status of relay 2 is indicated at LED Rel 2.

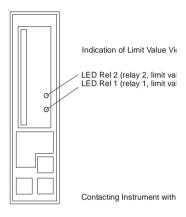

# Switching Mode and Switching Status of Relays and Indicator LEDs

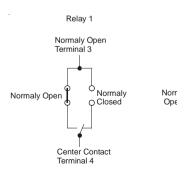

Working Current Model (nOP)					
Limit Value Switching Point	Measured Value (MW) >< Limit Value (LV)	NO Contact (factory setting) Terminals 3, 4 or 5, 6	NC Contact (jumper repositioned) Terminals 3, 4 or 5, 6	LED indication depending upon selected limit value	
	MW > LV	open	closed	not illuminated	
Lo1 2	MW < LV	closed	open	illuminated	
	MW > LV	closed	open	illuminated	
Hi1 2	MW < LV	open	closed	not illuminated	


Closed-Circuit Current Model (nCL)				
Limit Value Switching Point	Measured Value (MW) >< Limit Value (LV)	NO Contact (factory setting) Terminals 3, 4 or 5, 6	NC Contact (jumper repositioned) Terminals 3, 4 or 5, 6	LED indication depending upon selected limit value
	MW > LV	closed	open	not illuminated
Lo1 2	MW < LV	open	closed	illuminated
	MW > LV	open	closed	illuminated
Hi1 2	MW < LV	closed	open	not illuminated

# 3.4 External Control Inputs



## Attention!

Terminals 8, 9, 10 and 11 are electrically connected to the measurement input. Insulation at external switching elements must be grounded appropriately for prevailing measurement input potential.

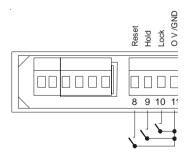

#### Reset

The entire display can be cleared by establishing a connection between terminals 8 and 11.

#### Attention:

This connection causes resetting of the microprocessor. A segment test is performed for approximately 3 seconds after this connection has been interrupted. The device then resumes normal operation. Previous programming remains intact


## Freezing the Display Value (hold function)

The currently displayed value can be frozen during normal operation by establishing a connection between terminals 9 and 11. This does not influence the measuring cycle.

## Disable Programming (lock function)

Configured parameters can be protected against change by establishing a connection between terminals 10 and 11. See chapter 7.1, page 24, for exceptions regarding limit value configuration.

## 4. Operation

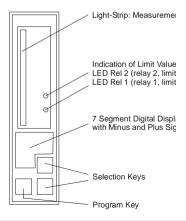

#### 4.1 Limit Value Test

After pressing the  $\hat{1}$  key, limit value 1 appears at the display (as **Lo1** or **Hi1** depending upon how the switching function has been programmed). The device is returned to the normal operating mode by pressing the P key.

The same applies to the  $\downarrow$  key for limit value 2.

# 4.2. Display Test

The display test is started by pressing the P key. The odd numbered segments (1, 3 ... 35) at the light-strips and the horizontal segments at the 7 segment display are activated and light up for portrait for-mat devices.


If the P key is pressed again, the even numbered segments (2, 4 ... 34) at the light-strips and the vertical segments at the 7 segment display are activated and light up for portrait format devices.


After pressing the P key a third time, all of the segments at the entire display are activated and light up.

The device can be returned to the normal display mode by once again pressing the P key.

## 4.3 Measuring Range Selection

The measuring range selection takes place by means of Jumper on the measuring range plate. In addition the equipment must be described, opened as under point 3.3. To the individual measuring range below specified Jumper position applies:

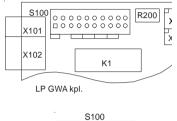

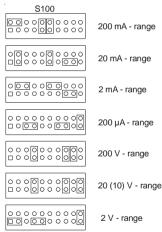

The indicator values for the zero point and/or the final value are stopped by the measuring range adjustment (see point 6.6) or by hardware- and/or software calibration (see point 6.7 and/or 6.8).

# 5. Basic Device Settings

Parameter	Function	Setting Range	
bri	Display brightness (LEDs and light-strip) 0 7 [5 1)		
4 20	Measuring range matching		
ASt	Display range lower limit (start)	-999 999	
AEn	Display range upper limit (end)	-999 999	
0 20	Measuring range matching		
ASt	Display range lower limit (start)	-999 999	
AEn	Display range upper limit (end)	-999 999	
± 20	Measuring range matching		
ASt	Display range lower limit (start)	-999 999	
AEn	Display range upper limit (end)	-999 999	
Pt	Measuring range matching <sup>4)</sup>		
°C/°F	Display in degrees Celsius or <sup>4)</sup> Fahrenheit		
2,4L/3L	2 / 4-wire connector or 3-wire connection <sup>4)</sup>		
rES	Measuring range matching <sup>4)</sup>		
200 / 2k / 20k	Resistance range <sup>4)</sup>	200 <b>Ω /</b> 2 k <b>Ω /</b> 20 k <b>Ω</b>	
2,4 L / 3L	2/4-wire connector or 3-wire connection <sup>4)</sup>		
the	Measuring range matching <sup>4)</sup>		
J/K/R/S	Thermocouple type selection <sup>4)</sup>		
°C/°F	Display in degrees Celsius or Fahrenheit		
НСА	Hardware calibration		
ZEr	Display range lower limit -999 999		
SPA	Display range upper limit -999 999		

Parameter	Function	Setting Range	
PCA	Software calibration		
OFS	Offset adjustment	-999 999	
SCA	Measured value scaling factor	-9,99 9,99	
dP/.dP/dP.	Decimal point		
FIL	Mean value generation based upon 0 to max 32 measured value	0; 2; 4; 8; 16; 32 2)	
SSt	Lower light-strip scale limit (start) with reference to the digital display	-999 999	
SEn	Upper light-strip scale limit (end) with reference to the digital display	-999 999	
SOr	Light-strip minimum scale value (orgin) with reference to the digital display	SSt≤SOr≤SEn	
nCL / nOP 3)	Switching mode: closed-circuit current (normaly closed) / working current (normaly open) for all relays		
L-L <sup>3)</sup>	Schaltfunktion der Relais 1 und 2	L-L L-H H-H H-L	
Lo1 / Hi1 <sup>3)</sup>	Switching point for limit value 1	-999 999	
Lo2 / Hi2 <sup>3)</sup>	Switching point for limit value 2 -999 999		
HYS 3)	Hysteresis 0 100 [0 ¹ ¹]		
Loc 3)	Lock limit values Loc, FrE [FrE 1)]		
diS / On	Switch digital display on or off diS / On diS / OFF		

<sup>1)</sup> Factory default setting

## 6. Programming

The following parameters can be configured in the indicated order:

- LED and light-strip brightness
- Measuring range matching
- Decimal point
- Sampling rate for mean value generation
- Scale ranges with light-strip minimum value
- Switch digital display on or off

<sup>2)</sup> A setting of either 8, 16 or 32 must be used for Pt100 sensors and thermocouples.

<sup>3)</sup> Only for devices with limit value read-out

<sup>4)</sup> At A1410-MF does not activate

The following additional parameters can be configured for devices with limit values:

- Relay switching mode
- Relay switching function
- Switching point values
- Relay hysteresis
- Lock limit values


## **Enabling Programming**

The lock function must be released in order to enable programming, i.e. contact between terminals 10 and 11 must be broken. If programming has not been enabled, **Loc** is displayed when the programming menu is opened. If this is the case, previously programmed values can be queried but not changed.

See chapter 7.1, page 26, for exceptions to this rule.

## **Programming**

The measuring instruments are programmed at the factory in accordance with customer specific requirements. If programming has been enabled, the basic device settings can be changed with the three keys at the front panel. The **P** and ↑ kevs must be pressed simultaneously (first P and then 1) in order to enter the programming menu. The parameter desig-nation and the corresponding value blink alternately in order to provide the user with orientation. Values can be changed with the ↑ and ↓ kevs. The longer these keys are held depressed, the faster the value changes. The selected value is not saved to memory until the next parameter is queried by pressing the P key. Various possibilities are provided for adapting the display to the input quantity. The various range matching options for 0 ... / 4 ... 20 mA, 20 mA, Pt100, Res and thermocouples are dependent upon the utilized measuring module and may only be selected if the device has been equipped with the corresponding measuring module (see designation on the serial plate). A measuring range type and the corresponding parameter settings can then be selected. Incorrect selection of measuring ranges results in malfunction!

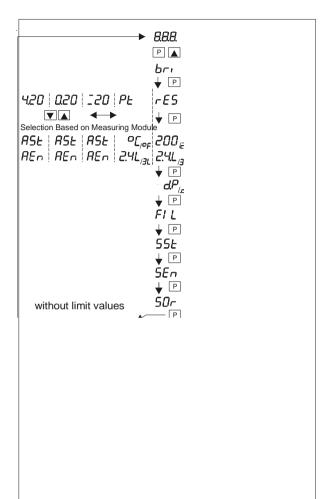

Programming Overview for Basic Device Settings

## 6.1 Adjusting Display Brightness

Display brightness can be adjusted with the **bri** parameter. A setting can be selected within a range of 0 to 7. Brightness is adjusted to 5 at the factory.

## 6.2 Light-Strip Adjustment

The light-strip indicates measured values at the analog scale. The display range can be set anywhere within the measuring range. The light-strip is preset at the factory. If the default settings need to be changed, this is accomplished in the program menu starting with the SSt parameter (see "Programming Overview for Basic Device Settings" on page 17).

#### 6.3 Lower Scale Limit

SSt and a numeric value blink alternately at the 7 segment display. This number corresponds to the digital display value which repre-sents the lower scale limit at the light-strip (minimum scale value is at the bottom for portrait format devices, and at the left for land-scape format devices). This value can be changed with the  $\Uparrow$  and  $\Downarrow$  keys. The selected value is saved to memory by pressing the P key, and the upper scale limit then appears at the display.

# 6.4 Upper Scale Limit

SEn and a numeric value blink alternately at the 7 segment display. This number corresponds to the digital display value which repre-sents the upper scale limit at the light-strip (maximum scale value is at the top for portrait format devices, and at the right for landscape format devices). This value can be changed with the  $\hat{\parallel}$  and  $\downarrow$  keys. The selected value is saved to memory by pressing the P key, and the minimum scale value then appears at the display.

#### 6.5 Minimum Scale Value

**SOr** and a **numeric value** blink alternately at the 7 segment display. This number corresponds to the digital display value which repre-sents the minimum scale value, i.e. the point within the scale (SSt ... SEn) at which the light-strip starts.

This value can be changed with the  $\ \ \ \$  and  $\ \ \ \ \$  keys. A value which lies between SSt and SEn must be selected. Other values are not displayed. The selected value is saved to memory by pressing the P key, and the display is returned to the lower scale limit parameter.

## Example:

	ght-Strip Indicator ference to the digital disp		SSt (lower scale limit)	SEn (upper scale limit)	SOr (minimum scale value)
0		150	0	150	0
0	<del></del>	150	0	150	150
100	$\longrightarrow$	0	100	0	100
100	<del></del>	0	100	0	0
-150	← 0 →	150	<sup>-</sup> 150	150	0

The measuring instrument automatically calculates the correspond-ing parameters and returns to the normal operating mode. If no programming keys are activated for a period of more than 3.5 minutes, the measuring instrument automatically returns to the normal operating mode.

# 6.6 Measuring Range Matching for 0 ... 20 mA, 4 ... 20 mA and $\pm$ 20 mA

The parameters **ASt** and **AEn** allow for the entry of a display range without necessitating any further balancing. After selecting the measuring range, **ASt** and a **numeric value** blink alternately at the 7 segment display. Select the value which should be displayed as the measuring range lower limit with the  $\widehat{\parallel}$  and  $\downarrow$  keys. Save the selected value to memory with the P key.

**AEn** and a **numeric value** then blink alternately at the 7 segment dis-play. Select the value which should be displayed as the measuring range upper limit with the ↑ and ↓ keys. Save the selected value to memory with the P key. The measuring instrument automatically calculates the corresponding parameters, and then displays the decimal point configuration window.

# 6.7 Measuring Range Matching with HCA (hardware calibration)

This selection allows for balancing with a calibrator. During balancing, input quantities must be applied to the instrument which correspond to the measuring range lower and upper limits.

After selecting the **HCA** function, **ZEr** and a **numeric value** blink alter-nately at the 7 segment display. Apply the value which corresponds to the measuring range lower limit to the measurement input. Use the and keys to select the value to be displayed at the measur-ing range lower limit. Save the selected value with the P key. SPA and a numeric value blink alternately at the 7 segment display. Apply the value which corresponds to the measuring range upper limit to the measurement input. Use the ↑ and ↓ keys to select the value to be displayed at the measuring range upper limit. Save the selected value to memory with the P key.

The instrument automatically calculates offset and scaling factor, saves these values and displays decimal point configuration.

### Attention:

If the calculated values for offset or scaling factor are not within the setting range, Err / InP appears at the 7 segment display. Exit the programming function with the P key.

# 6.8 Measuring Range Matching with PCA (software calibration)

Balancing is accomplished without a calibrator during measuring range matching with PCA by calculating offset and scaling factor. Offset and scaling factor are then set digitally by the instrument. After selecting the PCA function, OFS and a numeric value blink alternately at the 7 segment display. The offset value can be selected with the ↑ and ↓ keys. Save the selected value to memory with the P key. SCA and a numeric value then blink alter-nately at the 7 segment display.

## Calculating Offset (OFS)

The offset value is the number of digits the display is shifted from the "normal" zero point.

The offset value (OFS) is calculated with the following equation without taking the decimal point into consideration:

$$OFS = ASt - \frac{MSt - (AEn - ASt)}{MEn - MSt}$$

ASt = display range lower limit

MSt = bottom of scale

AEn = display range upper limit

MEn = top of scale

# Calculating Scaling Factor (SCA)

The scaling factor is used to match the display range to the scale range of the input signal. The scaling factor value (SCA) is calcu-lated with the following equation without taking the decimal point into consideration:

$$SCA = SCAalt * \frac{(MEn - MSt)\alpha}{(AEn - ASt)a}$$

SCA old = scaling factor<sup>1)</sup>
ASt old = displ. range l. limit<sup>1)</sup>
AEn old = displ. range u. limit<sup>1)</sup>
MSt old = bottom of scale<sup>1)</sup>
MEn old = top of scale<sup>1)</sup>

SCA = scaling factor<sup>2)</sup>
ASt new = display range I. limit<sup>2)</sup>
AEn new = display range u. limit<sup>2)</sup>
MSt new = bottom of scale<sup>2)</sup>
MEn new = top of scale<sup>2)</sup>

## Example:

A measuring instrument has been configured as follows: 0 ... 10 V scale range corresponds to 0.0 ... + 99.9 display range. This configuration needs to be changed to the following:

 $2 \dots 10 \text{ V}$  scale range corresponds to  $-10.0 \dots + 99.9$  display range.

ASt = -100 (without decimal point), MSt = 2v AEn = 999 (without decimal point), MEn = 10VThis results in the following:

$$OFS = -100 - \frac{2 * (999 - (-100))}{10 - 2}$$

set to -375

$$SCA = 1 * \frac{(10 - 0)}{(999 - 0)} * \frac{(999 - (-1))}{(10 - 1)}$$

set to 1,38

<sup>1)</sup>Which was selected at the measuring instrument before programming

<sup>2)</sup>Which is to be selected by means of reprogramming

## 6.9 Setting the Decimal Point

 ${
m d}{
m P}$  is displayed at the 7 segment display with the selected decimal point configuration.

Example:

**dP.** is displayed for the following decimal point configuration: xx.X

.dP is displayed for the following decimal point

configuration: x.XX

dp is displayed for no decimal point, i.e. XXX

The desired decimal point configuration can be selected with the  $\Uparrow$  and  $\Downarrow$  keys. Save the selected value to memory with the P key.

## 6.10 Mean Value Generation and Display

Mean value generation and display, using from 0 (no mean value generation) to 32 values in discrete steps of 2, 4, 8 and 16, is provided for with the **FIL** function. This allows for the stabilization of fluctuating display values. The sampling rate is approximately 8 measurements per second.

### 6.11 Limit Value Function

The limit value function is selected immediately after lightstrip settings have been completed. The selected limit value function appears at the 7 segment display.

Function	Parameter
Relay switching mode	nCL or nOP
Relay switching function	L-L, L-H, H-L or H-H
Relay switching hysteresis	HYS
Lock limit values	Loc or FrE

## 6.12 Relay Switching Mode

After the light-strip settings have been completed, the selected relay switching mode appears at the 7 segment display.

The desired switching mode (**nCL** or **nOP**) can be selected with the  $\Uparrow$  and  $\Downarrow$  keys. Save the selected value to memory with the P key.

## 6.13 Relay Switching Function

Depending upon the selected relay switching mode (nCL or nOP), the selected switching function appears at the 7 segment display (L-L, L-H, H-H or H-L):

- L-L = All limit value relays indicate limit value violation if the measured values are less than the selected limit values.
- L-H = Relay 1 for limit value 1 indicates limit value violation, if the measured value is less than the selected limit value 1. Relay 2 for limit value 2 indicates limit value violation, if the measured value is greater than the selected limit value 2.
- H-H = All limit value relays indicate limit value violation if the measured values are greater than the selected limit values.
- H-L = Relay 1 for limit value 1 indicates limit value violation, if the measured value is greater than the selected limit value 1. Relay 2 for limit value 2 indicates limit value violation, if the measured value is less than the selected limit value 2.

The desired switching function can be selected with the  $\Uparrow$  and  $\Downarrow$  keys. Save the selected value to memory with the P key.

## 6.14 Setting Relay Switching Hysteresis

**HYS** and a **numeric value** blink alternately at the 7 segment display.

This value corresponds to the selected switching hysteresis in  $\pm$  digits.

Select the desired number of digits with the  $\Uparrow$  and  $\Downarrow$  keys. Save the selected value to memory with the P key.

## 7. Setting the Limit Values

The limit values can only be changed during operation if they haven't been locked in the programming mode. The limit values are accessed by simultaneously pressing the P and the 
↓ keys. If Loc appears at the display, the instrument has been protected against limit value changes. No changes can be made in this case. The instrument is automatically returned to normal operation after approximately 3 minutes.

If the instrument has not been protected against limit value changes, the switching mode for the respective relay appears at the 7 segment display. The desired switching mode can be selected with the  $\Uparrow$  and  $\Downarrow$  keys, and the setting is saved to memory with the P key.

Depending upon the selected relay switching function (nCL or nOP), Lo1 and a numeric value, or Hi1 and a numeric value blink alternately at the 7 segment display. The displayed numeric value corresponds to limit value 1.

The desired limit value can be selected at the 7 segment display with the ↑ and ↓ keys. Save the selected value to memory with the P key.

## 7.1 Locking the Selected Limit Values

Either FrE or Loc appears at the 7 segment display.

- FrE = Limit values can be changed, even if programming has been disabled by establishing an external connection between terminals 10 and 11.
- Loc = If programming is disabled, the limit values cannot be changed, i.e. the limit values are locked if a connection has been established between terminals 10 and 11.

Select the desired value with the  $\ \ \$  and  $\ \ \ \ \$  keys. Save the selected value to memory with the P key. The measuring instrument saves all settings to memory and the digital display on/off selection appears.

## 7.2 Switching the Digital Display On and Off

**diS** and **On**, or **diS** and **OFF** blink alternately at the 7 segment display. If diS / On is selected, the digital display remains active. If diS / OFF is selected, the digital display goes blank after the programming menu has been exited. Selection is made with the  $\Uparrow$  and  $\Downarrow$  keys. Save the selected value to memory with the P key and the instrument returns to normal operation.

Even if the digital display has been deactivated (diS / OFF), it is acti-vated briefly for the duration of the following operations:

- Programming
- Change or query selected limit values
- Display test

#### 8. Technical Data

Digital

Display

Type: Analog 35 segment light strip 2 limit value I FDs

7 segment LED, 3 digits

with minus and plus sign

Display Color red

Light-Strip Height / Length approx. 45 mm

Brightness adjustable from 0 to 7

Display Range –999 to 999
Character Height approx. 8 mm

Polarity displayed automatically

Decimal Point programmable

Overload Display ----

Underload Display \_\_

Scale

Format portrait
Scale Height / Length Scale 45 mm

Color swan white

Graduation and Labelling black, acc. to meas. range

option: as requested

Input

Current Module:

Voltage Drop max. 2 V

Voltage Module

Input Impedance  $>1M\Omega$  for measurements >2 V  $>70k\Omega$  for measurements <2 V

**Analog-Digital Conversion** 

Measuring Method dual-slope

Sampling Rate approx. 8 measurements

per second

Measuring Time approx. 40 ms

#### **Error Limits**

For Basic Device

Without Module ± (0.1% of reading + 2 digits)

DC Module ± (0.1% of reading + 2 digits)

Temperature Coefficient  $\pm$  (0.1% of reading + 2 digits + 150 ppm / K

SMRR > 30 dB at 50 Hz
CMRR > 120 dB related to

meas.range 200mV at 50Hz

**Control Inputs** 

Device Test (Reset) controlled via floating

contact

Freeze Display (Hold) controlled via floating

contact

Disable Programming (Lock) controlled via floating

contact

Relays

Contacts 1 NO contact (or NC

contact)

Switching Capacity 5 A / 30 V AC / DC Switching Time 5 A / 30 V AC / DC max. 200 ms

Switching Hysteresis adjustable from 0 to 100

digits

**Power Supply** 

230 / 115 V AC 15%

50 / 60 Hz /

90 ... 260 V DC approx. 3 W

**Electrical Safety** 

Types IEC 61010-1 / EN 61010-1 /

VDF 0411 Part 1

Safety Class

Overvoltage Category CAT II
Contamination Level 2

Protection IEC 60529 / EN 60529

Housing Front Panel IP 65 Terminals P 00

### **EMC**

Interference Immunity IFC 61326-1 / +A1 EN 61326-1 / +A1

Interference Emission IFC 61326-1 / +A1 FN 61326-1 / +A1

**Operating Voltage** 

DC Voltage/Current Module 300 V

### **Ambient Conditions**

Operating Temperature 0 ... 50 °C Storage Temperature -20 ... 70 °C Relative Humidity max 85%

Vibration Resistance IFC 61010-1/FN 61010-1

## Housing

Material plastic, ABS Front Dimensions 96 x 2

92 +0.8 x 22.2 +0.3 mm Panel Cutout Panel Thickness min. 1 to max. 45 mm.

Bezel Height 5 mm

Installation Depth max. 126 mm plus wiring

approx. 0.2 kg Weight

Terminals screw terminal blocks for wire with cross section of

up to 2.5 square mm

Mounting plastic mounting tabs Range 4 ... 20 mA Factory setting Bargraph 0 ... 100

Digital readout 0 ... 99.9

## 9. Repair and Replacement Parts Service DKD Calibration Laboratory and Rental Instrument Service

If required please contact:

GOSSEN Müller & Weigert

Kleinreuther Weg 88 D-90408 Nürnberg Telefon +49 911 3502-0 Telefax +49 911 3502-307 e-mail: info@q-mw.de

This address is only valid Germany. Please contact our representatives or subsidiaries for service in other countries.

# 10. Product Support

If required please contact:



# Metrix Electronics Limited

Minchens Court, Minchens Lane,

Bramley, RG26 5BH, U.K.

Tel:+44 (0)845 034 3234, Fax:+44 (0)845 034 3233

E-mail: sales@metrix-electronics.com Web: www.metrix-electronics.com

Printed in Germany - Subject to change without notice

3 - 349 - 120 - 04

GOSSEN Müller & Weigert Kleinreuther Weg 88 D-90408 Nürnberg Telefon +49 911 3502-0 Telefax +49 911 3502-307 e-mail: info@g-mw.de

